FreshMore 100

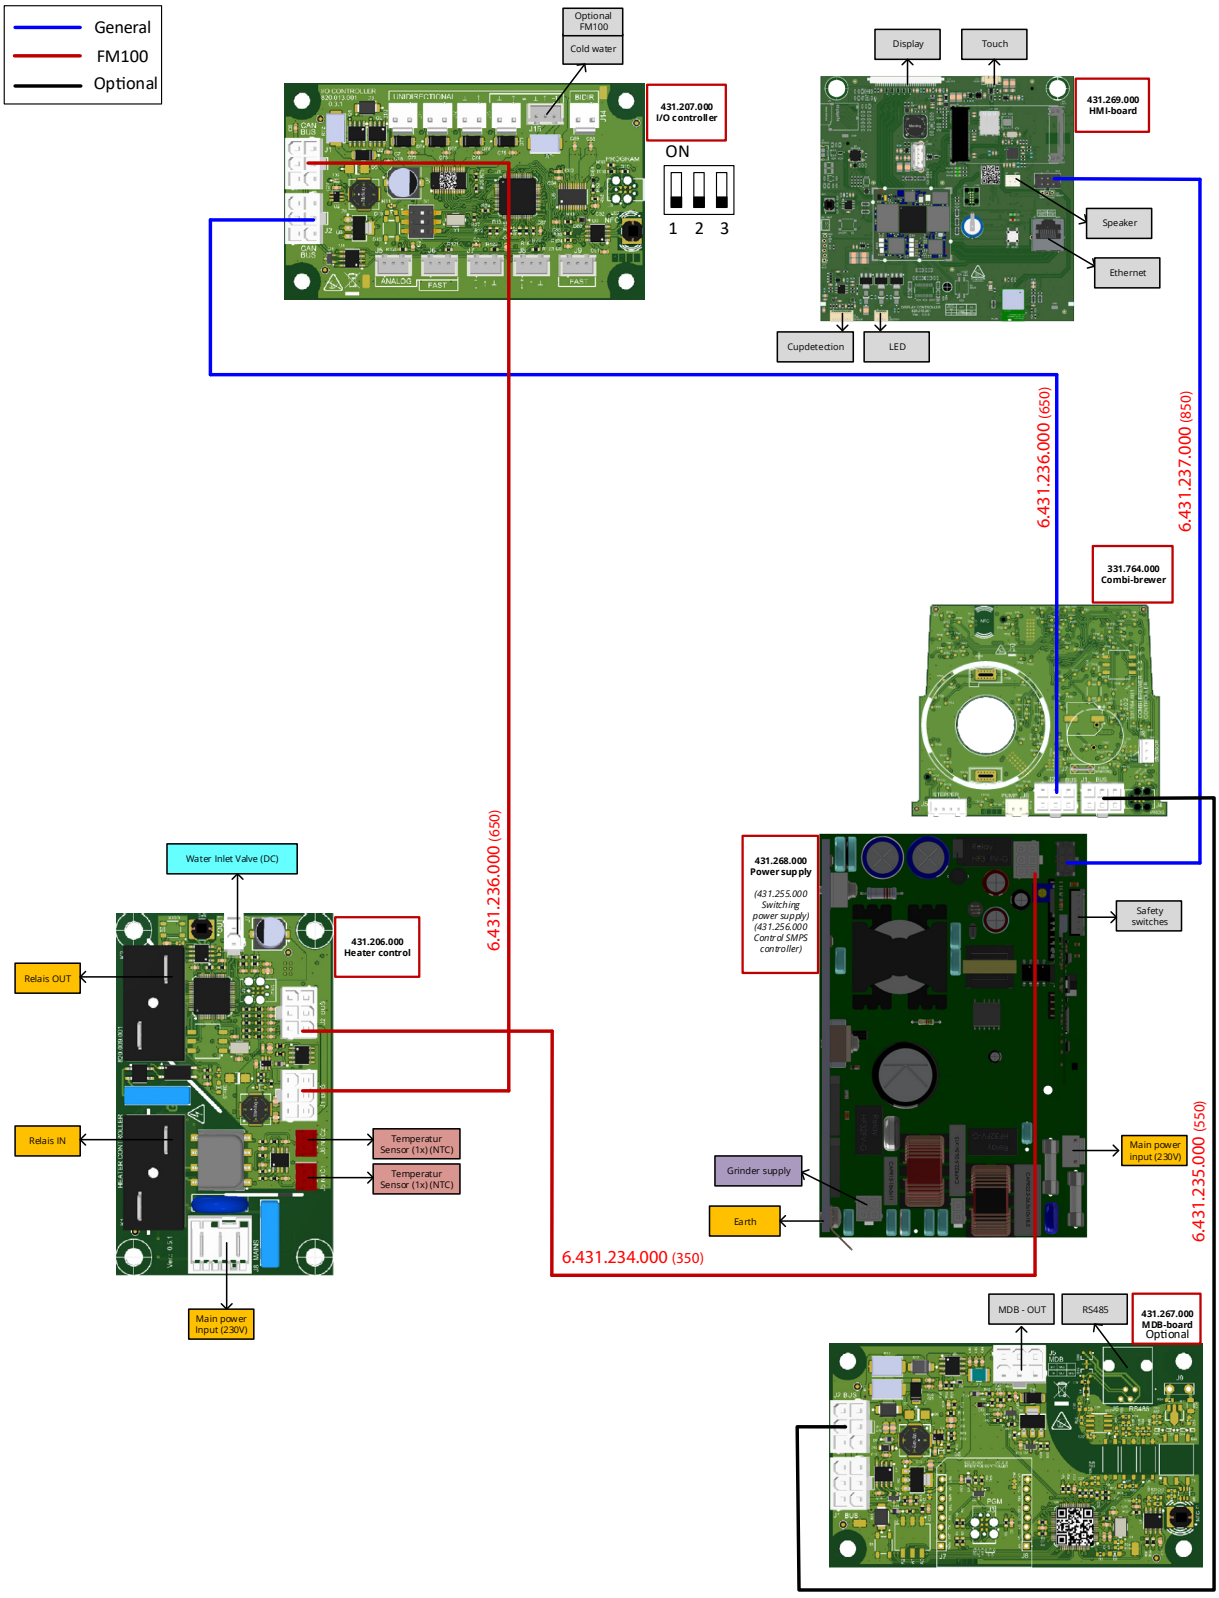

Original document by manufacturer
© 02-2025 VHH
Bravilor Bonamat B.V.

FreshGround 100

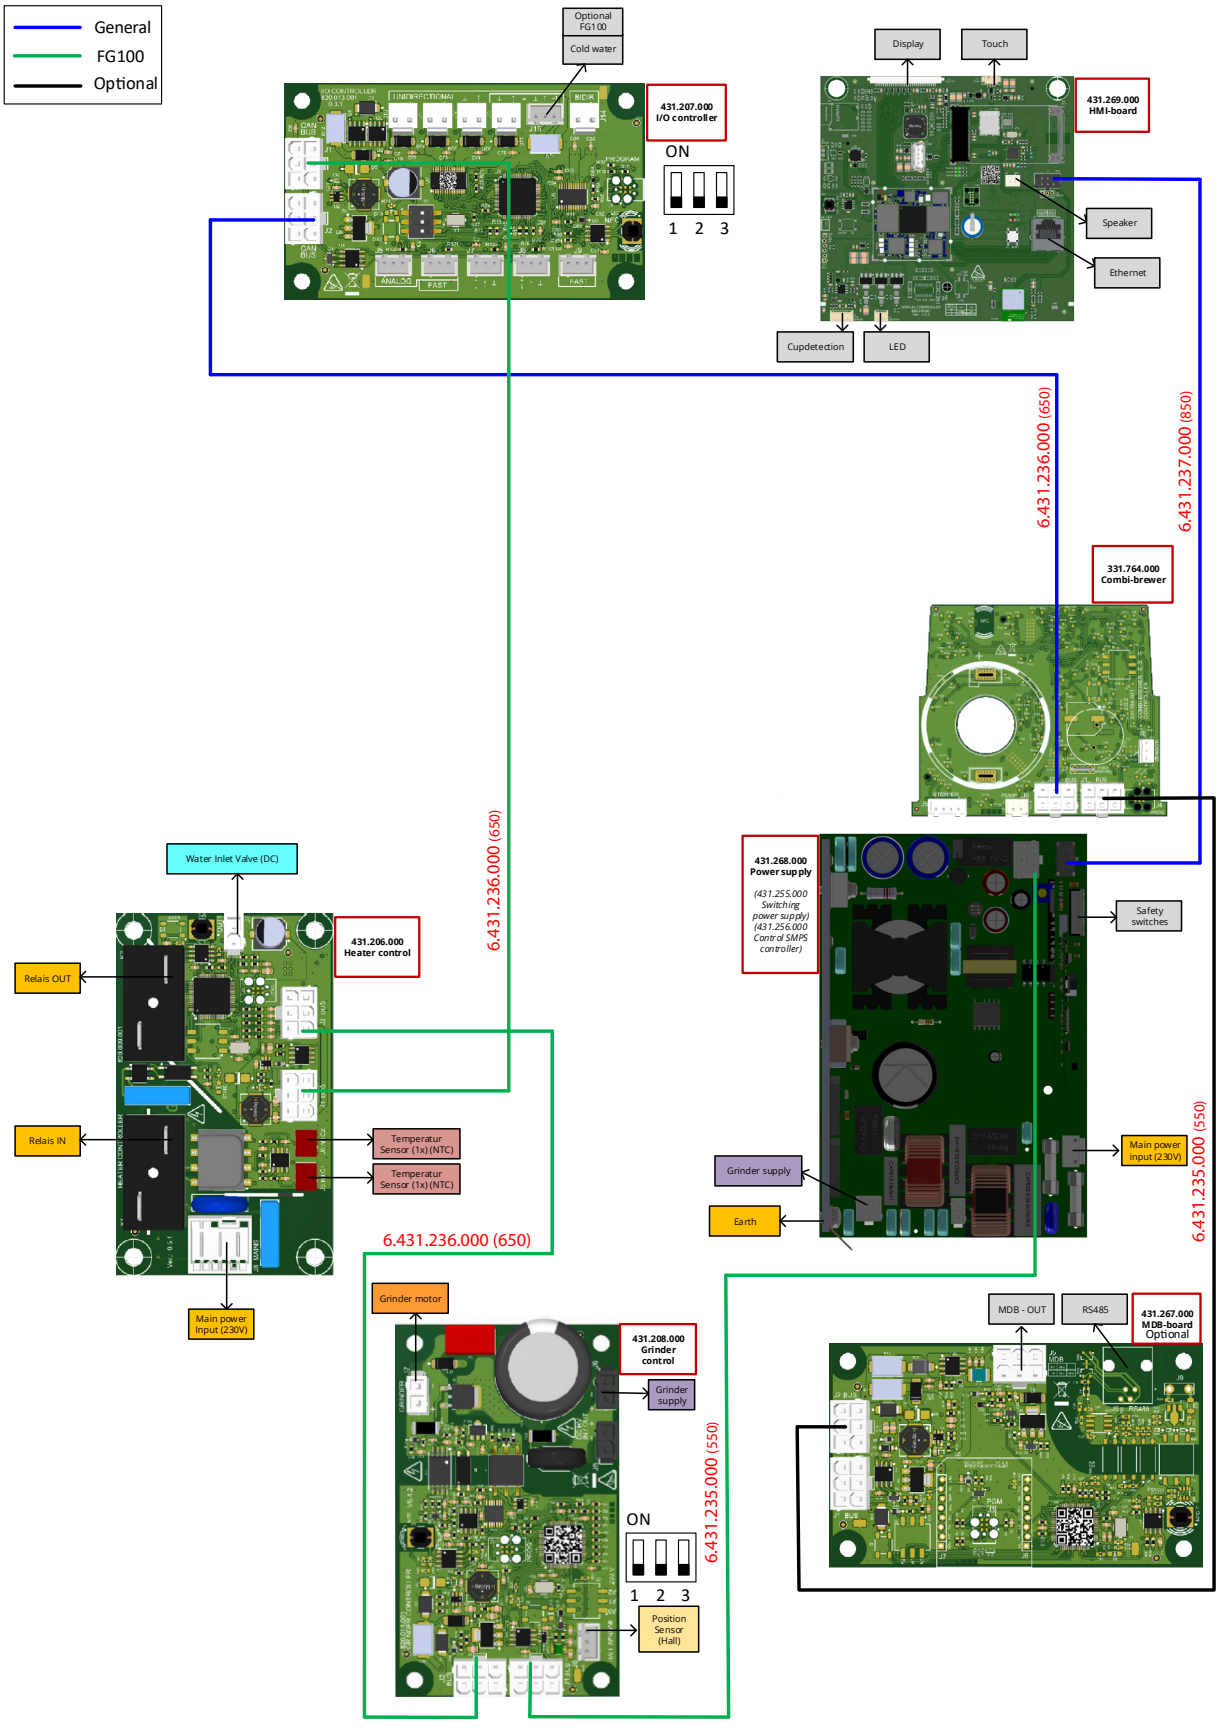

Original document by manufacturer
© 02-2025 VHH
Bravilor Bonamat B.V.

FreshMore 121

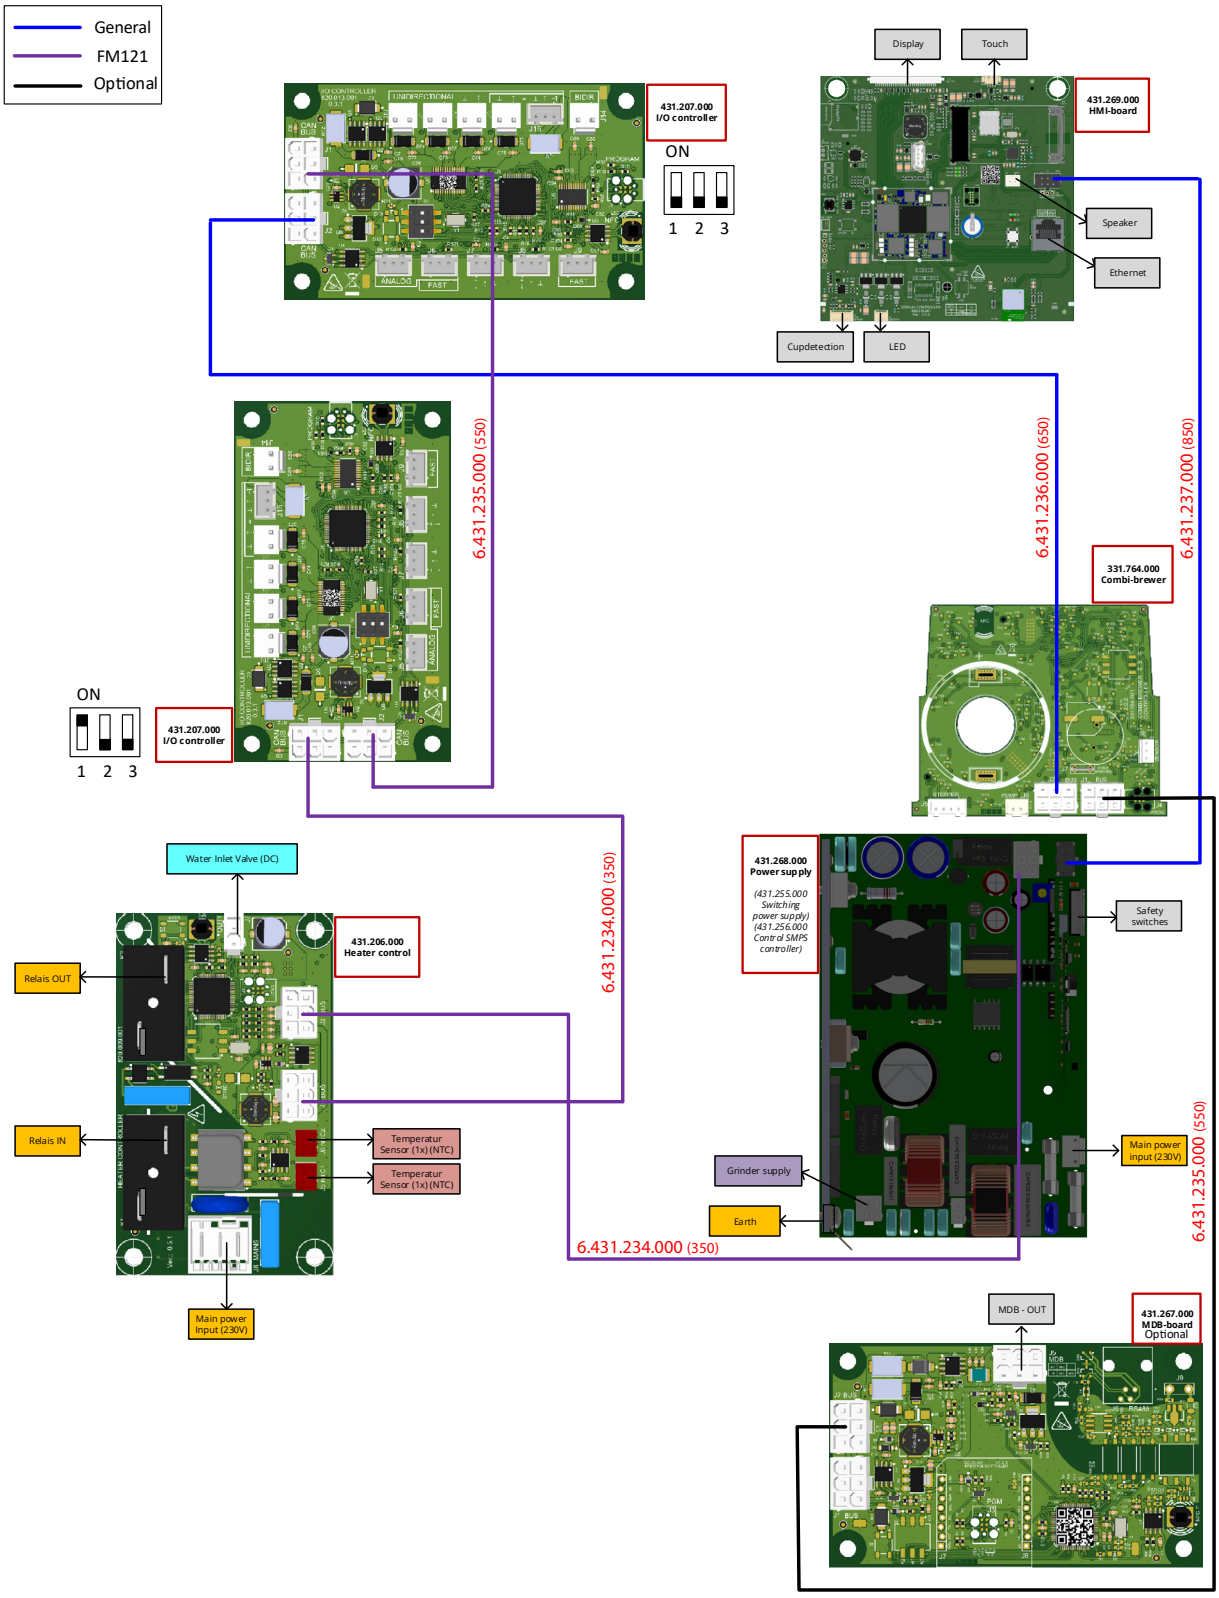

If the I/O controller 6.431.207.000 is replaced make sure that the dipswitches are set the same as the replaced board.
If the dipswitches are not setup the same as the replaced board it will lead to a non or wrong functioning machine.

Original document by manufacturer
© 02-2025 VHH
Bravilor Bonamat B.V.

FreshGround 121

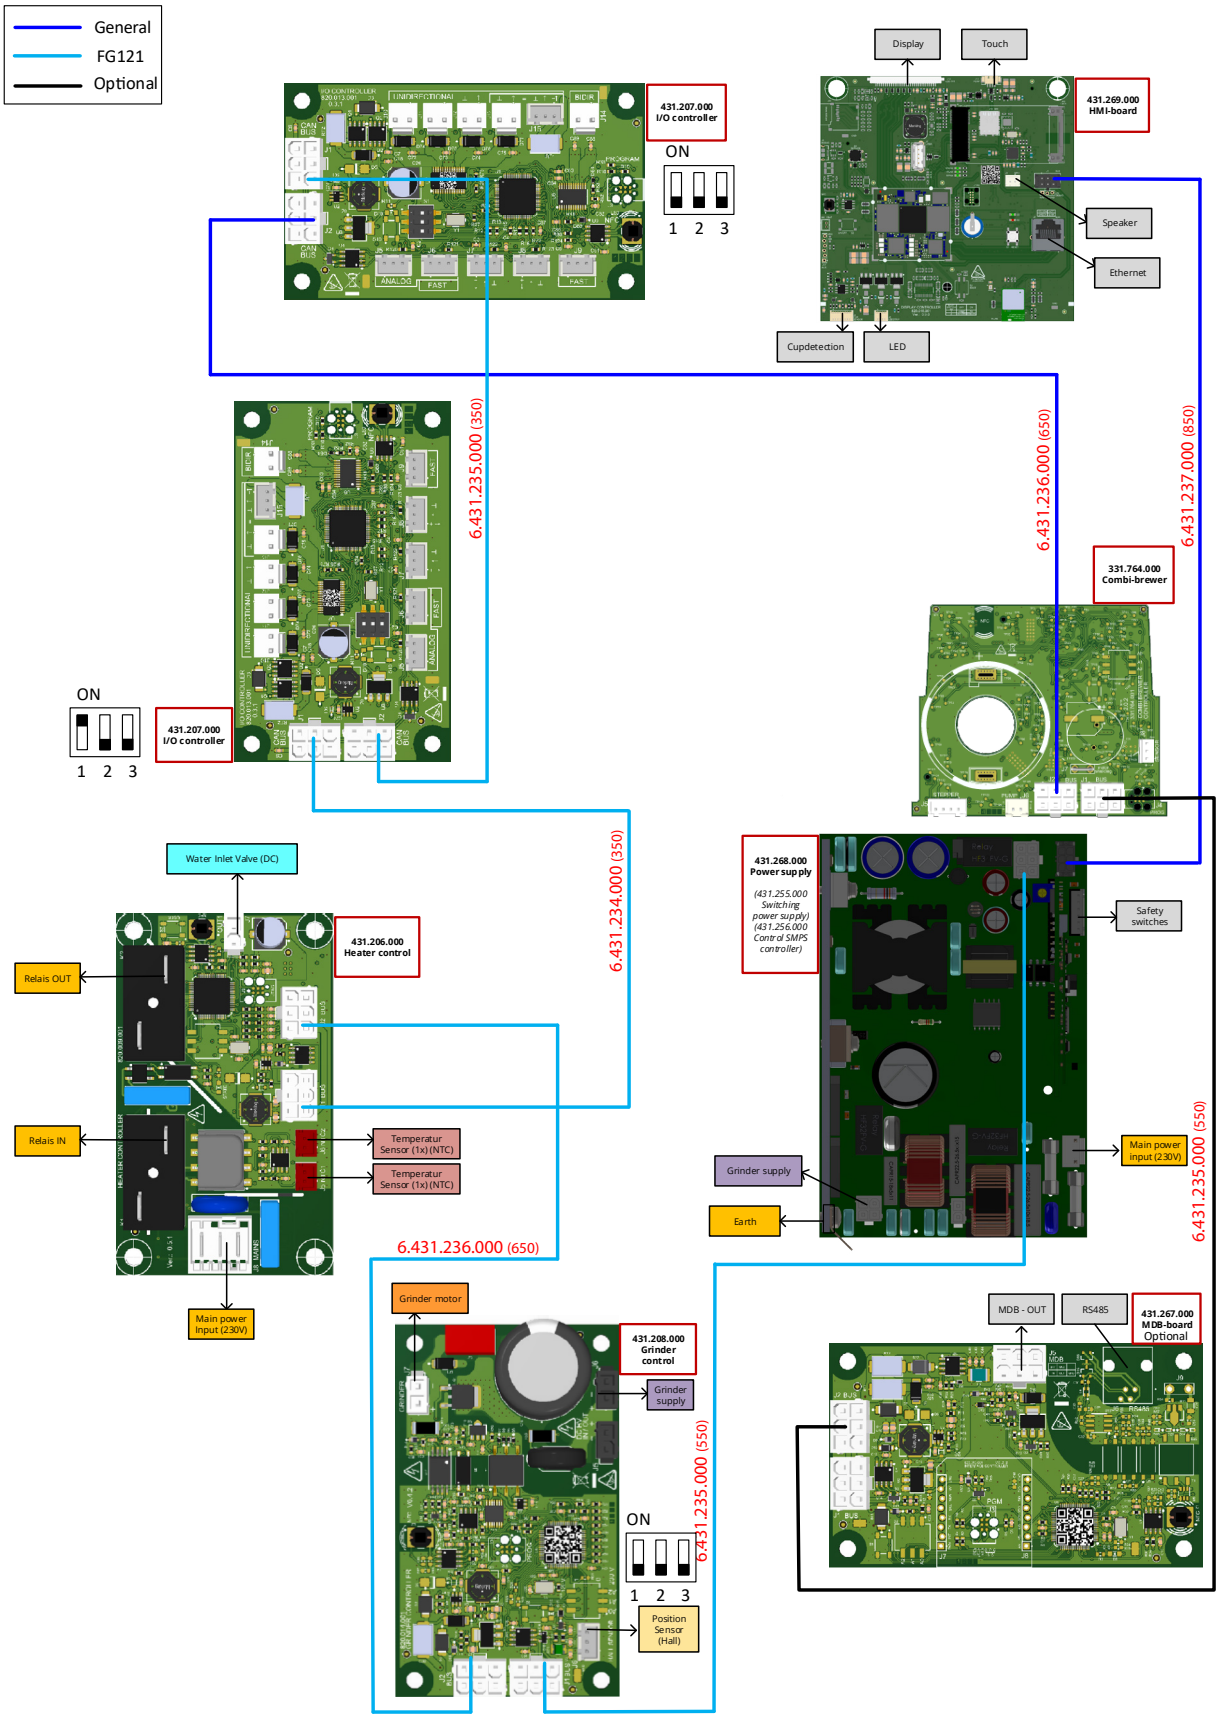

If the I/O controller 6.431.207.000 is replaced make sure that the dipswitches are set the same as the replaced board.
If the dipswitches are not setup the same as the replaced board it will lead to a non or wrong functioning machine.

Original document by manufacturer
© 02-2025 VHH
Bravilor Bonamat B.V.

FreshGround 133/143

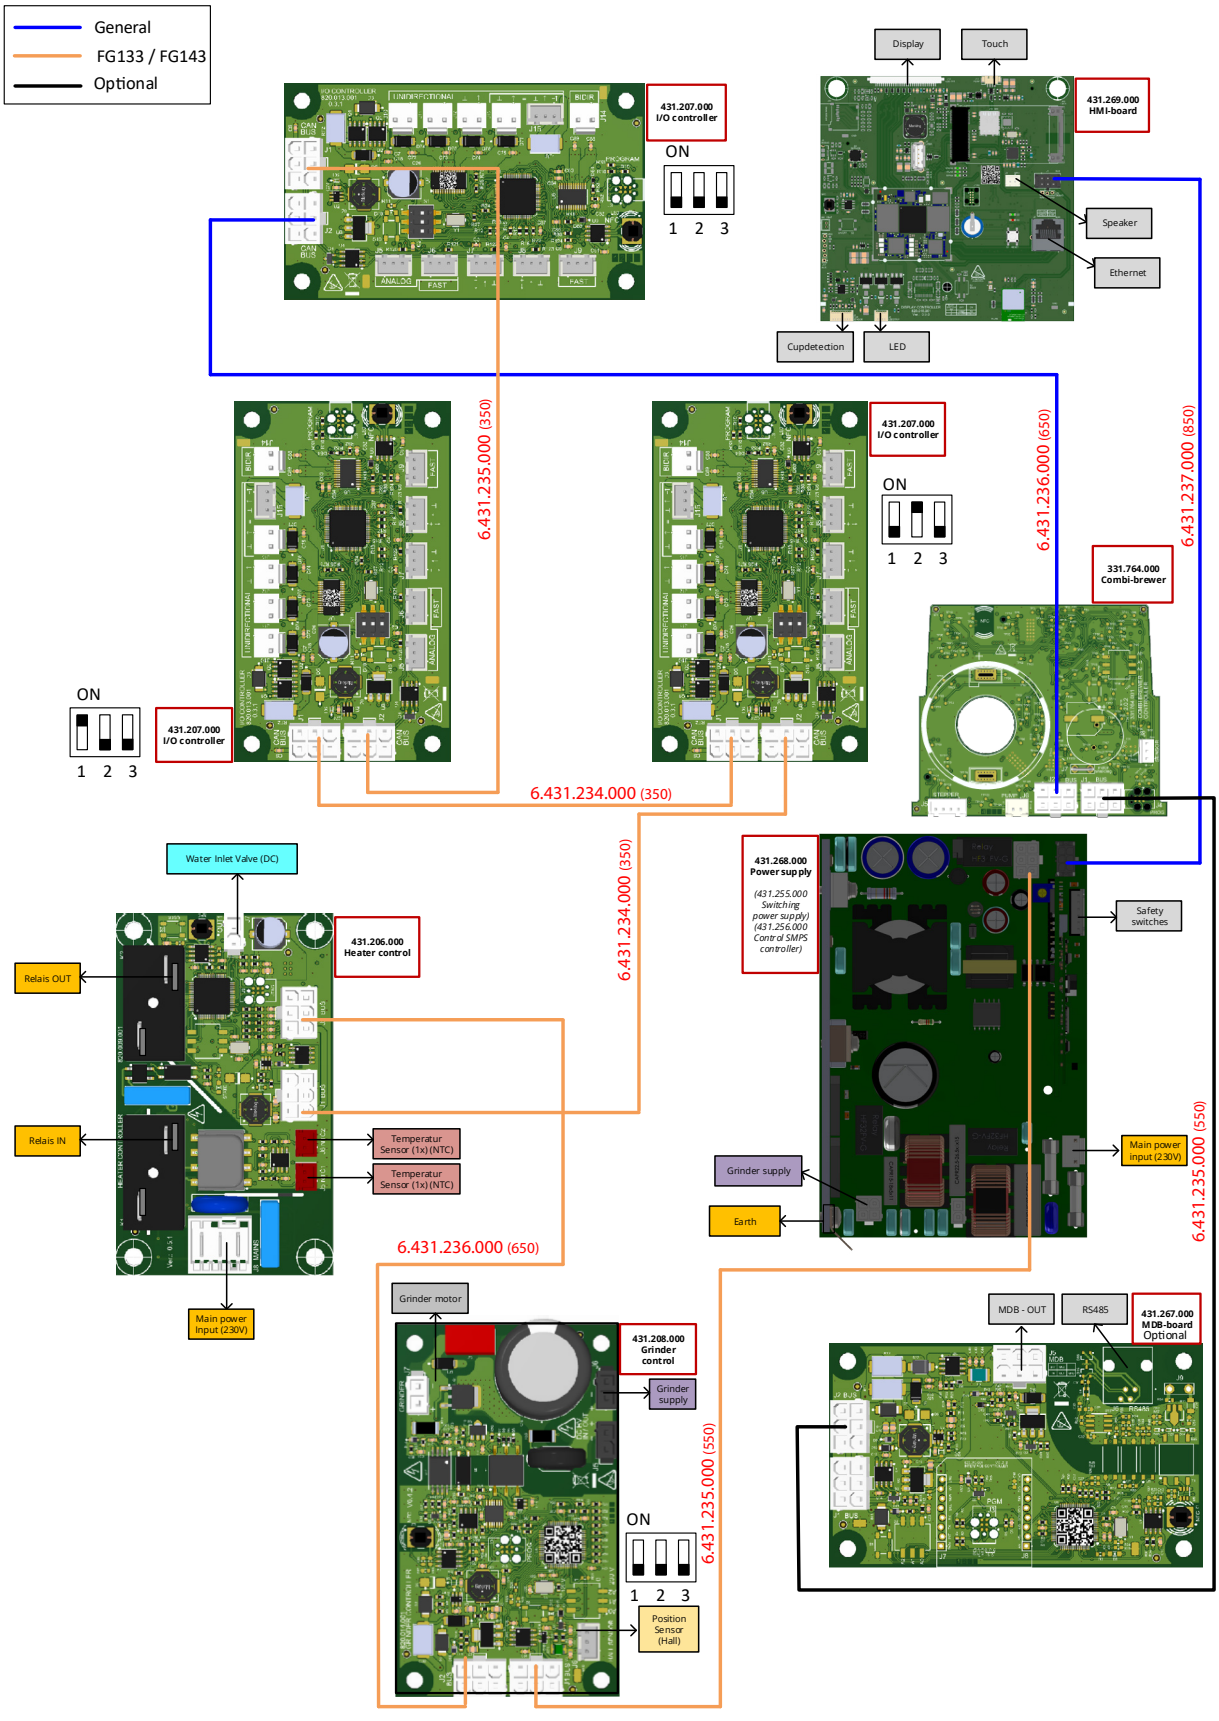

If the I/O controller 6.431.207.000 is replaced make sure that the dipswitches are set the same as the replaced board.
If the dipswitches are not setup the same as the replaced board it will lead to a non or wrong functioning machine.

Original document by manufacturer
© 02-2025 VHH
Bravilor Bonamat B.V.