



Enter recipe name Name recipe
(Unique name identifying a recipe)

7.4 2 sequences, 2 ingredients

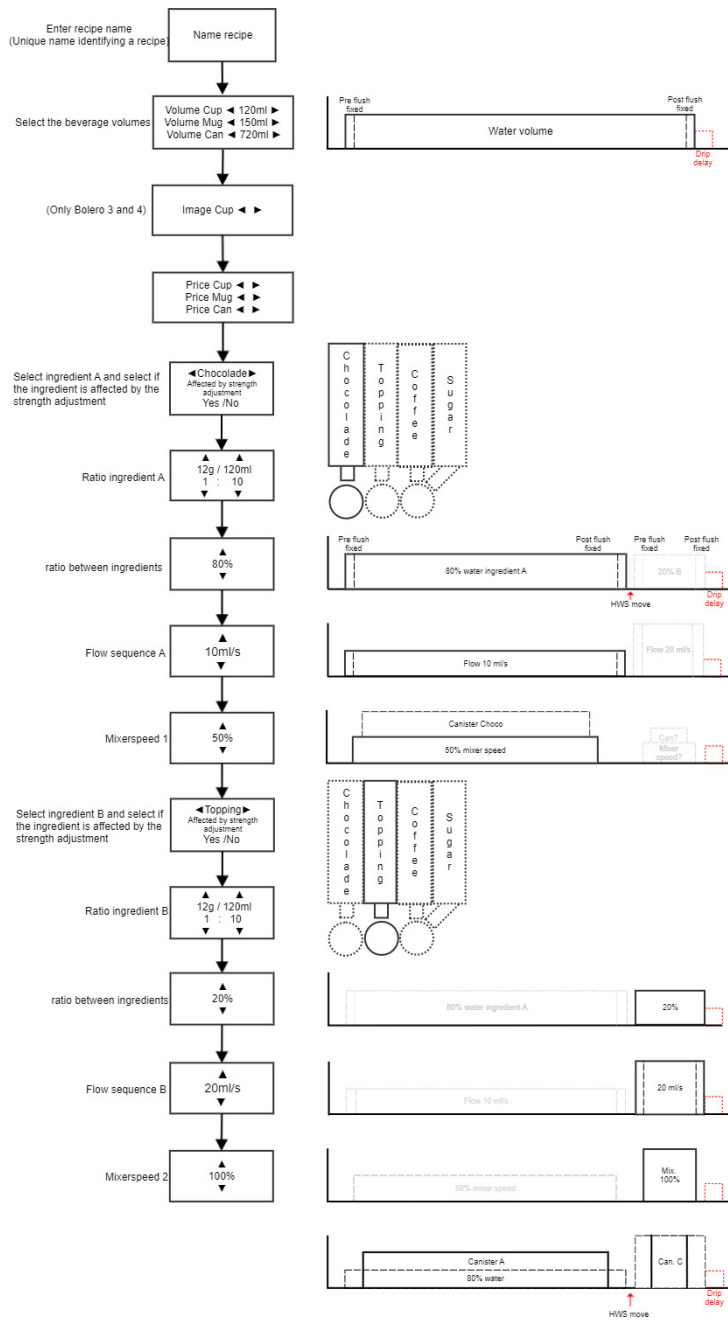

7.5 3 sequences, 3 ingredients

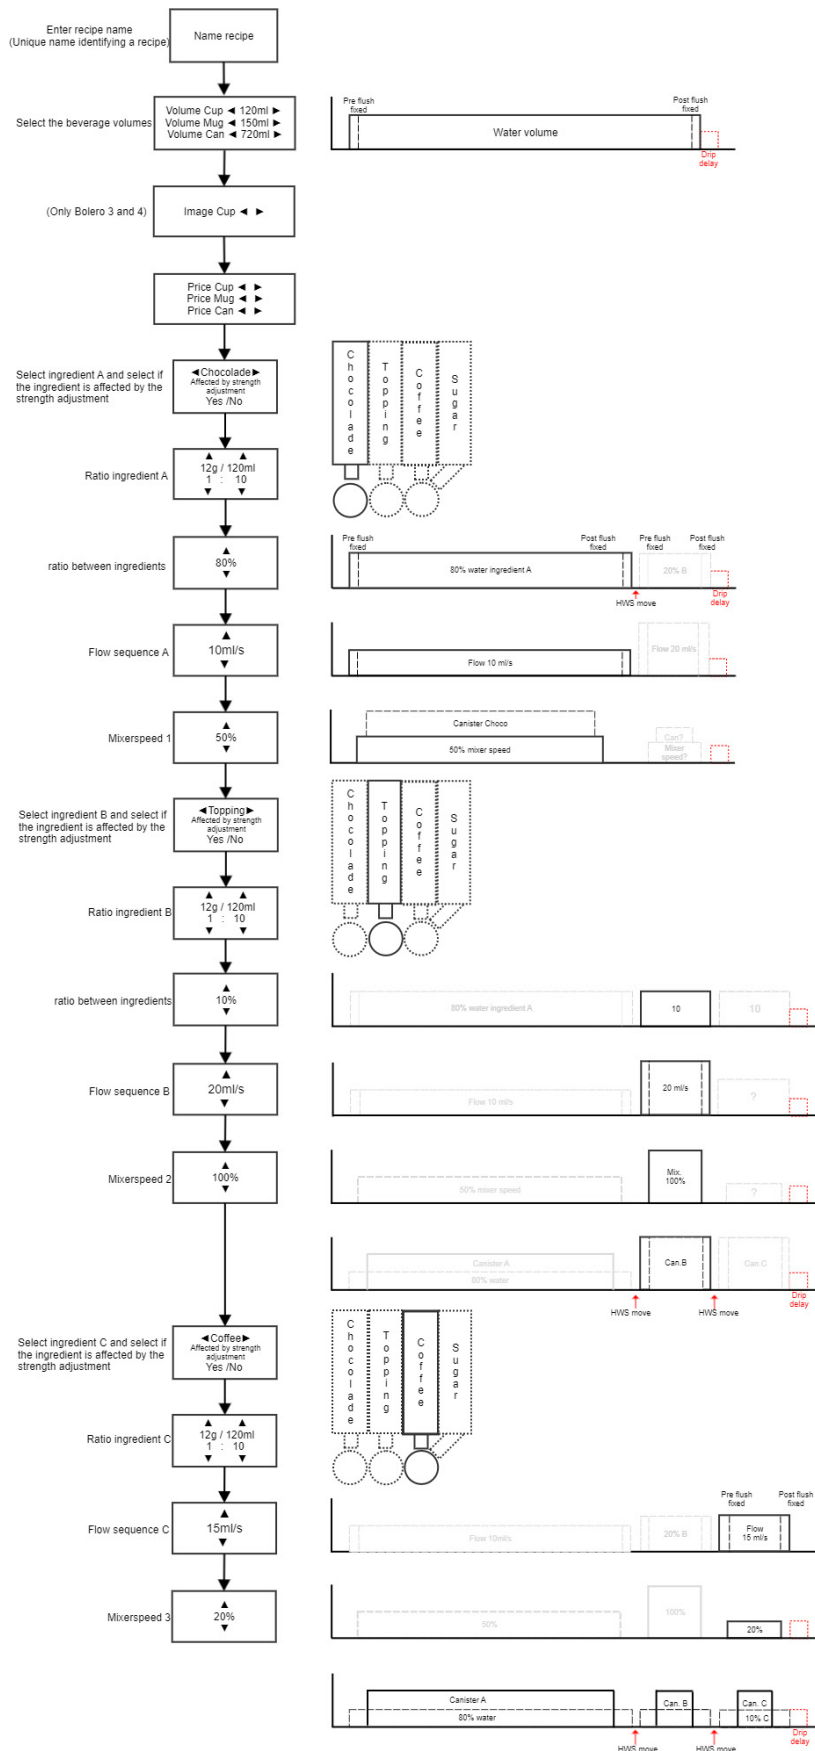


8. Additional information

8.1 Identification of the appliance

The appliance has an identification plate with specific information on it.

Always ask for the serial number, when you contact your client.

The serial number must be passed on to a Bravilor technical support employee if a complaint is submitted to them.

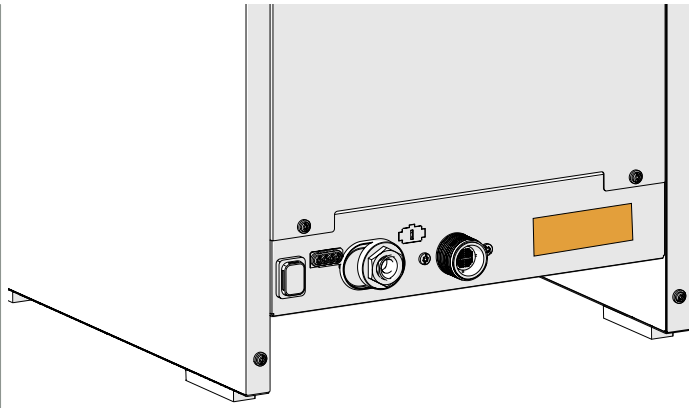

The identification plate for the Bolero Turbo can be found on the right-hand side at the back.

8.2 Replacing HMI board

Important information before getting started

When the service HMI-board is replaced on a machine, follow the below steps to update the software and load the correct images on the HMI-board.

- *Make sure that the service HMI board is placed on the machine where it will be used on.*

During the update of the firmware the configuration is taken from the I/O board and that determines which configuration (Bolero Turbo (XL) xx) the HMI board gets.

After the update of the firmware and the configuration is determined it can't be changed anymore.

Necessities for updating:

- » USB device
- » firmware x.x (download the latest version from our website)
- » Bolero Turbo beverage images (download from our website)
- *Some private labels can use other images than the standard "Bolero Turbo beverage images" and therefore have a specific name, use these instead.*

Procedure for updating the service HMI-board:

Step 1, Firmware update

- *Make sure that the service I/O board is installed correctly on the machine.*
- turn the machine on
- put the files '002.071.046 Bolero Turbo firmware x.x.bbp' and 'Bolero Turbo beverage images.bbp' on an USB device
- open the door of the Bolero and insert the service key
- insert the USB device
- press the button **install software from USB**
- select the file '002.071.046 Bolero Turbo firmware x.x.bbp' and press **start**
- the update process will take some time (about 7 minutes) and the machine will restart automatically when the update is ready
- *Please note that the beverage images will not be present after the firmware update, these will be imported in step 2.*

Step 2, Import images

The import of the images will restore the images.

- insert the USB device with the file 'Bolero Turbo beverage images.bbp' press the programming button on the inside of the door
- go to: software and use the arrow keys **◀ ▶** to go to the screen 'import settings', hold the import settings button for at least 10 seconds until 'import file & save settings as default' screen appears
- select the file 'Bolero Turbo beverage images' and press **start**
- the machine will ask if you want to overwrite the current default settings, press the **✓** button in the lower right corner, the images will be imported and set as default. When the images are imported the machine will restart automatically
- remove the USB device and the service key and close the door

The update procedure is finished.

Brewing your coffee

S I N C E 1 9 4 8