Service Information

TITLE : Sprso water inlet change

MODEL : All Sprso models

DATE : 2022-01-25 **NUMBER :** SI 220125

Reason for sending you this information

Because of a change in the water inlet of the Sprso this part doesn't fit older Sprso machines.

Cause:
With the old water inlet it was possible to place the water tank incorrect on the machine which could cause a leakage between the water inlet and water tank.

Solution:
For this reason the dimensions of the water inlet and the housing of the Sprso are changed.
The old and new part can not be exchanged with each other as the fit would not be good.
We have created a set of parts that fit older Sprso machines in case these should ever be changed.

For machines with a lower serial number as of **020002238255** the set must be used.

For machines with serial number **020002238255** or higher the parts can be exchanged separately.

Part information:

The set contains:
- water inlet
- sealing ring
- sieve
- back panel

New spare part:

6.000.431.029 water inlet and housing set Sprso


Modified spare part:

6.431.026.001 water inlet Sprso


Deleted spare part:

None

For machines with a lower serial number as of **020002238255**

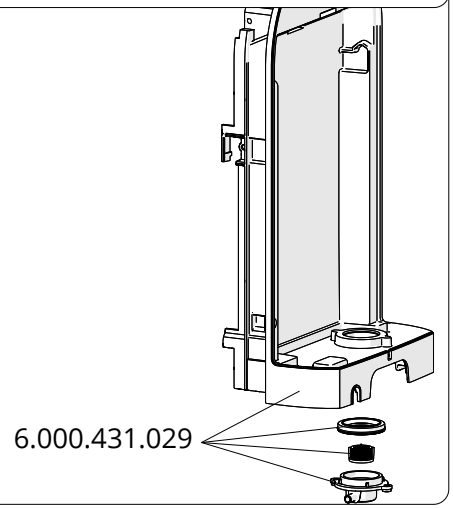

For machines with serial number **020002238255** or higher

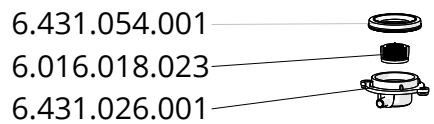

Copyright Bravilor Bonamat 2022
All Rights Reserved